

Incorrect Coil Storage




WHAT HAPPENED:

Coils in WHSE 1 have been binned with incorrect dunnage placement. 4x4's are missing from the ends of some piles and some coils do not have 2x4's on both sides. With incorrect dunnage placement, there is a strong potential for the entire stow to roll when the pile is being broken down.

SAFE WORK PRACTICES:

- All coils on the base row must be chocked with minimum 2x4 dunnage.
- Dunnage must be placed firmly and centrally against both sides of the coil.
- The ends of every row are to be secured with minimum 4x4 dunnage.
- For the safety of everyone, this safe work procedure must be adhered to.

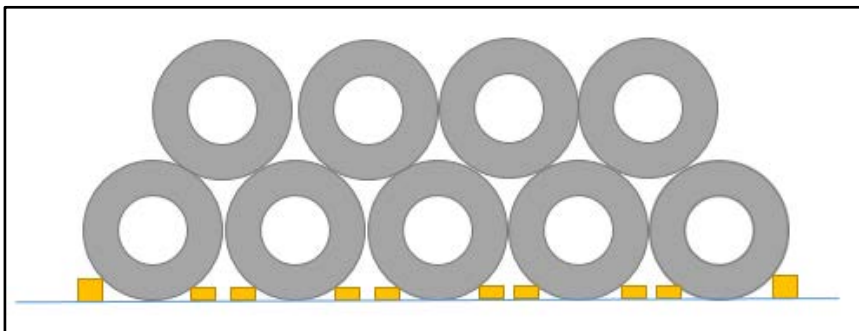

Correct Stowage
of coils

MAKE SAFETY A HABIT